

# NOVO-GLOSS™

60°  
20/60°  
20/60/85°



## Operating Instructions

Thank you for purchasing this Rhopoint product.  
Please read these instructions carefully before operating this product and retain them for future reference.

English

This instruction manual contains important information about the setup and use of your Rhopoint Novo-Gloss™. It is essential that the contents be read before powering up and operating the instrument.

If this instrument is passed to other users you must ensure that the instruction manual is supplied with the instrument. If you have any questions or require additional information about the Rhopoint Novo-Gloss™ please contact the Rhopoint Authorised Distributor for your region.

The technology and components used in the device are based on state-of-the art optic and electronics. As part of Rhopoint Instruments commitment to continually improving the technologies used in their products, they reserve the right to change information included in this document without prior notice.

© Copyright 2013 Rhopoint Instruments Ltd. All Rights Reserved.

Rhopoint Novo-Gloss™ and Rhopoint™ are registered trademarks of Rhopoint Instruments Ltd. in the UK and other countries.

Other product and company names mentioned herein may be trademarks of their respective owner.

No portion of the software, documentation or other accompanying materials may be translated, modified, reproduced, copied or otherwise duplicated (with the exception of a backup copy), or distributed to a third party, without prior written authorization from Rhopoint Instruments Ltd.

Rhopoint Instruments Ltd.  
12 Beeching Road,  
Bexhill-on-Sea,  
TN39 3LG  
United Kingdom  
Tel: +44 (0)1424 214291  
Fax: +44 (0)1424 730600

Email: [sales@rhopointinstruments.com](mailto:sales@rhopointinstruments.com)  
Website: [www.rhopointinstruments.com](http://www.rhopointinstruments.com)  
Revision A  
March 2013

# Contents

Storage and Handling	3
About the Rhopoint Novo-Gloss	Er
<b>ror! Bookmark not defined.</b>	
Accessories	4
Optional items	4
Functional overview	5
Power	6
Switching on the unit	6
Operation	7
Menu Screen	10
Batching Options	11
Setup Screen	12
Data Screen	13
Calibration Screen	14
Measurement Screen	15
Control Screen	16
Instrument Setup Screen	22
Maintenance Screen	23
About Screen	23
Appearance Theory	24
Rhopoint Novo-Gloss Glossmeter	24
Why is reflected appearance important?	24
Gloss	24
Technical Specification	26
Instrument Specification	27

## Storage and Handling

- This instrument contains precision optics and electronics. You should avoid knocking or dropping the device as the resulting impact could cause serious damage.
- In some circumstances the optical components in the instrument could become misted as a consequence of temperature change. It is recommended that the instrument is not used until it has stabilised to ambient temperature.
- Ensure that the instrument is not exposed to moisture, chemicals or to any corrosive vapours.
- Do not interfere or place any objects inside the measuring aperture as damage to the measuring system could occur.
- The instrument housing and screen are normally resistant to a variety of solvents however it is not possible to guarantee resistance to all chemicals, therefore the surfaces of the instrument should only be cleaned using a soft, moist cloth.
- Prevent exposure of the instrument to direct sunlight for prolonged periods and to continuous humidity and condensation.

## **Accessories**

The instrument is supplied as a standard package complete with all accessories required to calibrate and recharge the unit including:-

Rhopoint Novo-Gloss 60°, 20/60° or 20/60/85° Glossmeter

High gloss calibration tile including certificate

Cleaning cloth for calibration tile

BAM traceable instrument certificate

Mains Charger with four selectable mains input connectors (UK / Europe / US / Australia)

USB PC cable


Quick Start Operating Instructions

Protective instrument carry case

### **Optional items**

Mirror gloss calibration tile including certificate

## Functional overview

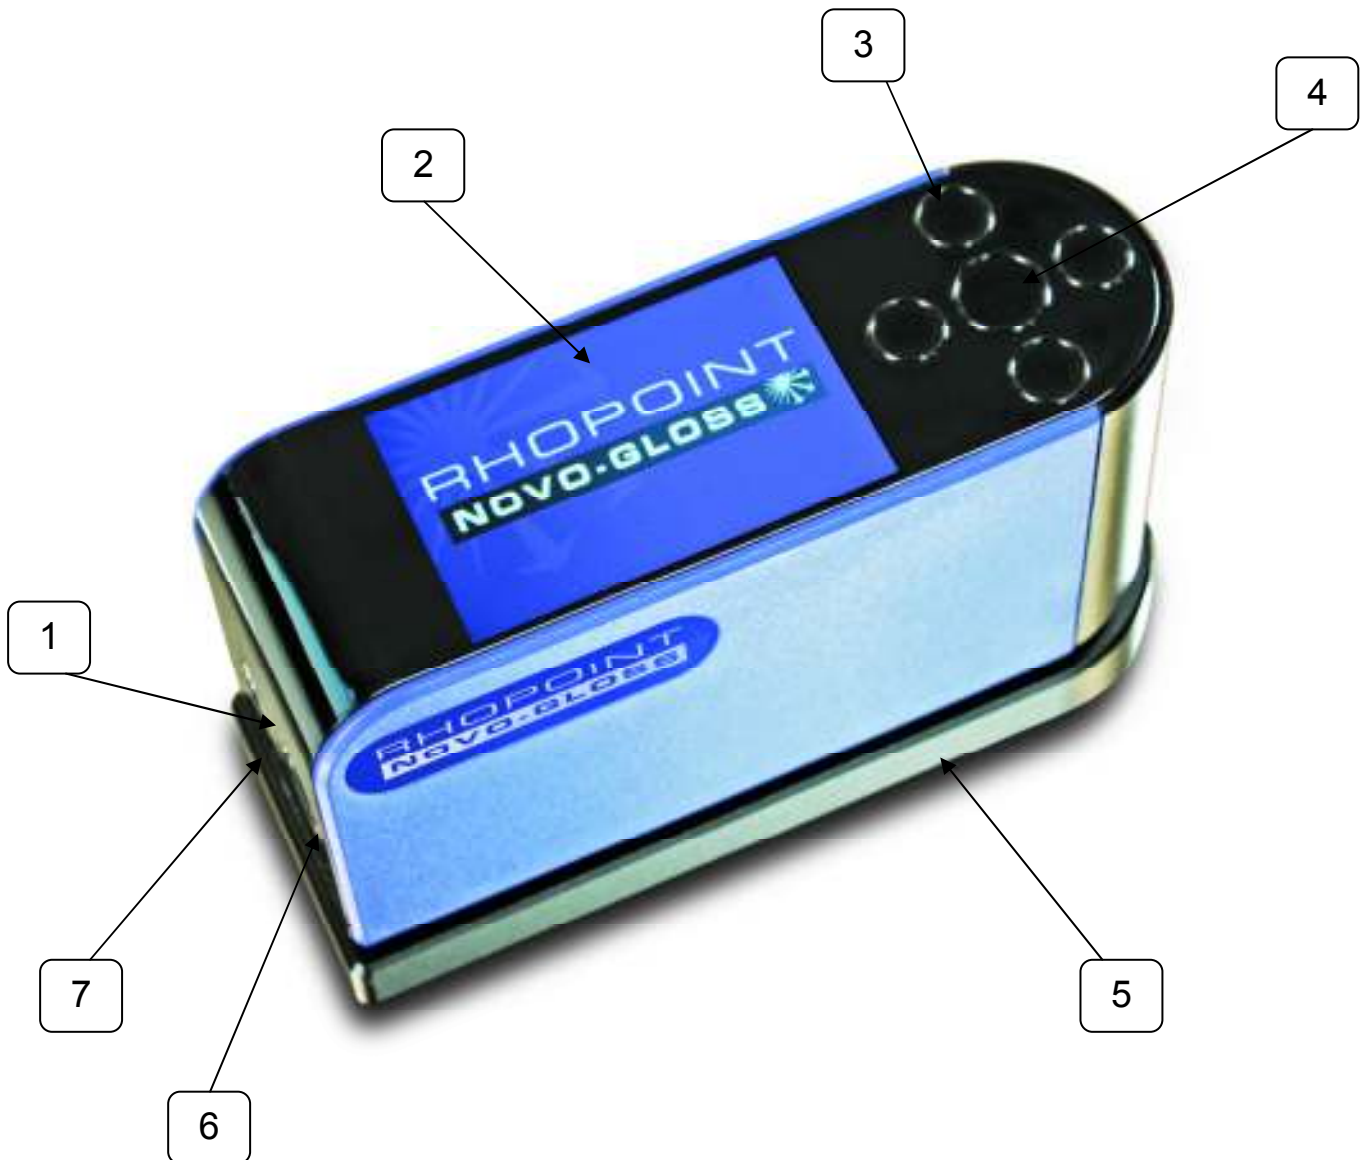

<u>Label No.</u>	<u>Function</u>
1	On / Off Button
2	High Resolution Graphic Display
3	Up/Down/Left/Right Buttons
4	Operate / Enter Button
5	Calibration Tile (magnetised)
6	Charger Input Connector
7	USB Connector

The instrument is controlled by pressing the relevant touch sensitive button. Functionality is dependent on whether the instrument is in menu or operate mode as detailed in the operation sections that follow.

## Power

The Rhopoint Novo-Gloss is powered by an integrated high capacity lithium ion cell.

Fully charged the instrument will operate continuously for >17 Hours or >20,000 readings.

A mains powered fast charger is provided with the unit, this will fully charge the unit when connected to the units charger input (6) in under 3 hours. The IQ can be operated with the charger plugged in.

Alternatively the Rhopoint Novo-Gloss can be powered and charged using the USB port (7), however due to the lower current available from most USB devices, the charge time will be a minimum of 6 hours.

Charging times will be longer if the instrument is operated during charging.

Lithium ION cells do not suffer from “memory effects” so it will not reduce the life of the battery if the fast charger or USB is used top up the battery between readings.

## Switching on the unit

To switch on the unit touch the On/Off button located between the USB and charging sockets.



The instrument will display the Rhopoint logo and then enter into the home screen displaying measurement parameters according to the instruments default settings or those previously configured.

Similarly the instrument is powered off by pressing the On/Off button for three seconds. The power Off feature of this button can be disabled in the setup menu.

## Operation

With the unit switched on and initialised the instrument will display the home screen as shown below.



In this mode, measurements can be made by simply pressing the operate button (4) on the instruments keypad.

Should the Auto Calibration option be set to ON in the settings menu (detailed later in the Instrument Settings section of this manual) a dialogue box will appear when the operate button is pressed as shown below



Two options are available: either to “Calibrate” the instrument on the calibration tile before making the measurement or to “Measure” without performing a calibration. Using the Left/ Right (3) and Enter (4) buttons on the keypad the required option can be selected.

By selecting “Calibrate” the instrument will perform a calibration and display a confirmation dialogue box when completed. Selecting the “Confirm” option will save the calibration information to the instruments memory, which will also be confirmed by the calibration tile Gloss and IQ readings appearing on the instruments display. Alternatively if “Cancel” is selected the display will return to the home screen.


By selecting “Measure” the instrument will perform a measurement and after 3 -4 seconds display the results.



## Operation



Pressing the Right button in the home screen will access the gloss statistics screen for the current batch for all three angles. Measurements can be taken whilst in this screen and the statistics will be updated.

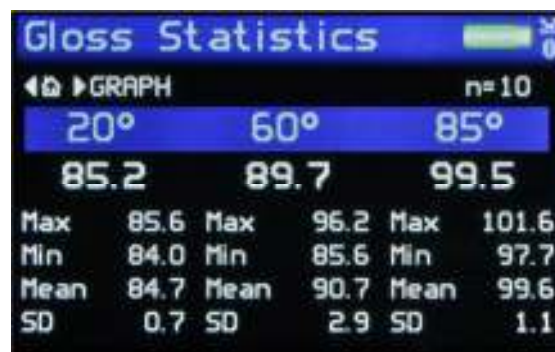

Pressing the Right button in the gloss statistics screen will access the gloss graph screen providing a graphical representation of the statistics data.



Pressing the Up / Down buttons gloss data can be displayed either all together or individually.

Measurements can be taken whilst in this screen and the graph will be updated after each reading. Pressing the Left button returns the display to the statistics screen.

Pressing the Right button the instrument returns the display to the home screen.

## Menu Screen

The Menu Screen is used for quick access to often used options. Pressing the Up and Down buttons navigates through the options, pressing the Enter button selects that option.



Selectable settings in the menu screen are:-

Memory – Set to ON, enables storage and batching of measurement results. The amount of available storage memory is also displayed.

Set to OFF – disables result storage.

With Memory ON:

Delete Last Reading – Delete last measurement, no. of measurements and statistics data updated to previous values.

Start New Batch – Start new batch of readings, Batch name is incremented by 1.

Clear Current Batch – Delete entire batch of measurements for current batch.

Delete All Batches – Delete all batches and measurements stored.

Batch Name – Default name is BATCH, a maximum of 8 user defined batch names can be used as detailed in the “Batching Options” section.

Calibrate Instrument – Perform a calibration of the instrument as detailed under “Operation”.

Switch Off – Turn off the instrument.

Pressing the Left button returns the display to the home screen.  
Pressing the Right button will access the Setup screen.

## **Batching Options**

The batching feature allows the user to group measurements together in batches. Each batch has associated statistics; the data for each batch can be accessed by connecting the instrument to a PC/MAC.

The current batch name is displayed on the home screen in the bottom left corner, the sample number within that batch is shown in the top right of the screen indicated with n=(sample number).

A new batch is started using the Start New Batch option in either the Menu screen or the Data menu, note that the batch name will increment as will the 'n' indicator.

The current batch can be cleared in the either the Menu screen or the Data Menu, the batch name will remain the same but the 'n' indicator will reset to zero.

Auto batch size is user defined using the Auto Batch option in the Data Menu. When the number of readings in the current batch reach the number set by the user the instrument will automatically increment the batch name and set the 'n' indicator to zero.

## **Viewing Batch Data**

To access the stored batch information connect the instrument to a PC/MAC using the USB data cable supplied.

A new device name "IQ-METER" can be viewed and accessed via "MY COMPUTER", in this device open the DATA folder. This folder contains subfolders which contain the data for each individual saved batch. Each reading is saved as an individual comma separated value (.csv) that contains Gloss, Haze, DOI/RIQ, RSpec, Time and Date of Reading, Serial Number and Full Goniophotometric data for all 512 diode elements.

Each reading also contains the statistics for the batch up to and including that reading. To access the STATISTICS for the whole batch, the last reading in the batch should be examined.

## **User Defined Batch Names**

Batch names are user definable. With the instrument connected to a PC/MAC, open the folder named "CONFIG". Within this folder there is a document named "batches". This is a .csv file that can be opened in Notepad, Excel or Wordpad.

User defined names should be saved in this document each name listed on a separate line. Ensure that the final line is terminated with a carriage return.

The format of these names should only contain letters, no numbers, spaces or other characters can be used.

Once completed save the file then switch the instrument off and on again to initialize the new batch names.

## Setup Screen



The Setup Screen is used to customise the instrument to the user's preference. Pressing the Up and Down buttons navigates through the options, pressing the Enter button selects that option.

Data and Batch Menu - Batch / Data options (See Data & Batch Menu Screen)

Calibration Menu - Calibration options (See Calibration Menu Screen)

Measurement Menu - Geometry setup (See Measurement Menu Screen)


Control Menu - Bluetooth setup (See Control Menu Screen)

Instrument Setup - Language, Date / Time and Power options (Setup Menu Screen)

Factory Menu - Pin locked menu options for Rhopoint authorised service centres

Pressing the Left button returns the display to the home screen.

## Data Screen

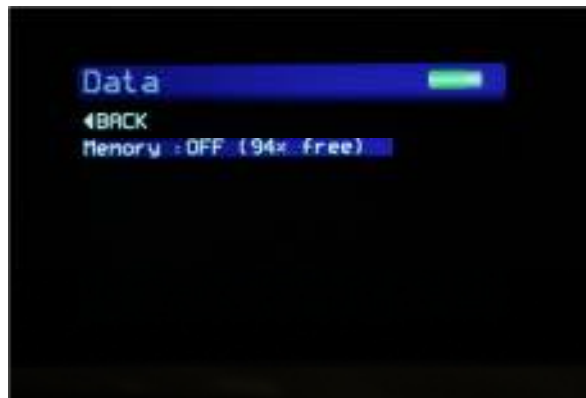

The Data Screen is similar in functionality to that of the menu screen but also allows the selection and setting of the Auto Batch size.

By selecting Auto Batch to ON the batch size can be selected between 1 - 999 by pressing the Left and Right buttons to select the relevant digit and the Up and Down buttons to increment / decrement the value. Pressing the Enter button saves the batch size.

If Batch names have been user defined, as detailed under Batching Options, selection of the Batch Name required is achieved by repeatedly pressing the Enter button with Batch Name selected.

Pressing the Left button returns the display to the home screen.

## Calibration Screen



The Calibration Screen is used to setup the instrument calibration to the user's preference. Pressing the Up and Down buttons navigates through the options, pressing the Enter button selects that option.

Selectable settings in the Calibration screen are:-

**Calibrate instrument** - Performs an instant calibration of the instrument; a dialogue box being displayed upon completion to either "Cancel" or "Confirm".

**Auto Calibration** - Set to ON, a dialogue box appears each time a measurement is taken as detailed under Operation.

Set to OFF, the dialogue box is disabled; measurements are made.

**Calibrate to** - Set to Black - a traceable gloss tile is used as the calibration standard

Set to Mirror - a traceable mirror tile is used as the calibration standard

**Tile Value 20, 60, 85** - Set the calibration values for either standard being used for calibration. Pressing the Enter button selects the value. Pressing the Left and Right buttons selects the relevant digit and the Up and Down buttons increment / decrement the value. Pressing the Enter button again saves the value.

**Error Detection** - Set to ON the instrument detects the condition of the calibration standard being used. If there are fingermarks or debris which cause it to fall outside the value set in Haze Tolerance an error message is displayed before calibration requesting that the tile be checked for cleanliness.

Set to OFF – Error detection is disabled, calibration is permitted irrespective of calibration standard condition.

**Haze Tolerance** - Set the tolerance for the standard being used for calibration. An ideal calibration standard should have zero haze, therefore setting this value anywhere between 0 – 9.9 defines the acceptable pass band. Pressing the Enter button selects the value. Pressing the Left and Right buttons selects the relevant digit and the Up and Down buttons increment / decrement the value. Pressing the Enter button again saves the value. Pressing the Left button returns the display to the home screen.

## Measurement Screen



The Measurement Screen is used to configure the instruments measurement parameters to the user's preference. Pressing the Up and Down buttons navigates through the options, pressing the Enter button selects that option.

Selectable settings in the Measurement screen are:-

**Auto Measure** – Enables or disables automatic measurement mode, used for monitoring surfaces for changes over a period of time. Pressing the Enter button selects the required measurement frequency of either 2, 5 or 10 seconds. When auto measure mode is activated a dialogue box is displayed after the Enter button is pressed and before the beginning of the measurement sequence indicating that it is activated. To stop auto measure simply press the Enter button once again at any time during the sequence.

**Range** – Selects gloss measuring range to:

- Auto – Full range
- Black – Standard gloss scale

**Mirror** - Extended scale for highly reflective materials, polished metals, requires calibration using Mirror standard.

**Geometry** – Select the angle(s) required for measurement either:

- 20, 60, 85 individually
- 20/60 Dual mode
- 20/60/85 Tri mode

Pressing the Left button returns the display to the home screen.



## Control Screen



The Control Screen is used to configure the instruments Bluetooth parameters to the user's preference. Pressing the Up and Down buttons navigates through the options, pressing the Enter button selects that option.

Enable Remote Control is not presently user configurable

Selectable settings in the Control screen are:-

Bluetooth – Enables or disables Bluetooth

Bluetooth Mode – Selects Bluetooth data mode:

RC – Not currently used (for future use)

Data – Basic data transfer mode (transmits On-Screen Parameters)

Data + - Not currently used (for future use)


Pressing the Left button returns the display to the home screen.

## Bluetooth Communication and Pairing

The Novo-Gloss has a Bluetooth function that allows readings to be instantly transmitted to a compatible PC.

20/60/85° Gloss, Haze & instrument serial number and service/calibration data can be instantly accessed by many PC applications including Excel, Word, Wordpad, OpenOffice or SPC packages.

## Pairing Procedure

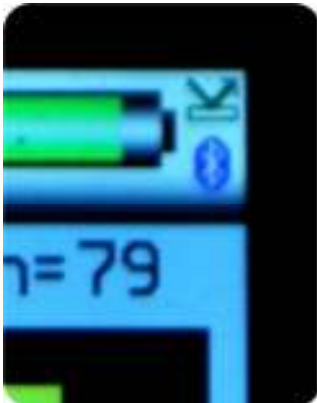

1. Switch on the Novo-Gloss.
2. The Bluetooth icon must be visible to allow pairing.



3. If the Bluetooth icon is not visible, enable it as detailed in Control Screen. Ensure that Bluetooth mode is set to either Data or Data+




4. In Windows, go to START menu and select "Devices and Printers."

5. In Devices and Printers screen Click "Add a device"





6. Windows will now search for available Bluetooth devices, double click on the icon that corresponds to the Novo-Gloss instrument.

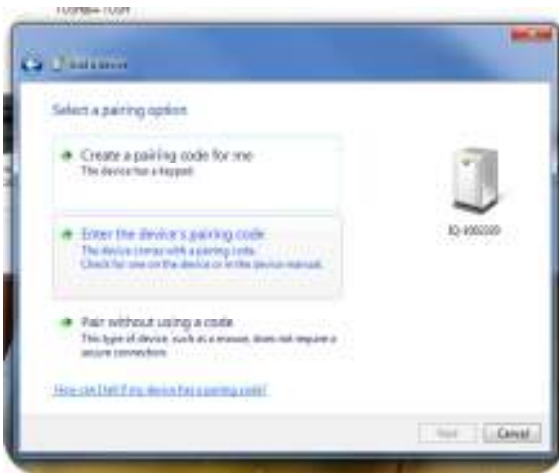

7: Click "Enter the devices pairing code" in the "Add a device" screen.



8: Enter the pairing code "0000".

Make sure the Novo-Gloss remains switched on throughout this process, to disable or extend auto power off refer to instructions detailed in Instrument Setup Screen that follow.




9. The Novo-Gloss is now installed on your PC and ready for connection to the Bluetooth Data Widget.

It is important to wait until windows displays the “Your device is ready to use” message before starting the data widget.

## Bluetooth Data Widget Installation Instructions

The Bluetooth (BT) Data Widget software supplied with the instrument is a mini program that converts transmitted measurement data into keystrokes that are automatically input into any open PC program.

1. Install the BT Data Widget software (BTdatawidget.exe) found on the cd supplied with the instrument.

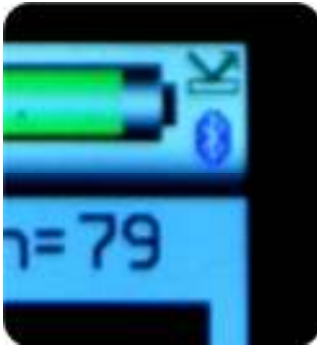

2. Check Bluetooth is switched on and that the instrument has been paired correctly



3. On the desktop click on the "Data Widget" icon to start

4. Click on the blue "refresh" arrow to search for paired Novo-Gloss & IQ(s).





5. The buttons are greyed out while the DATA widget searches for SWITCHED ON IQ(s) that have been PAIRED to the PC.



6. Look in the data widget drop down box to see discovered instruments.



7. Select the instrument required.

8. Click the tick to connect the instrument.



The transmitter icon now appears on the Novo-Gloss.

All readings will now be automatically transferred to any open windows package.

Download example EXCEL spreadsheets from Rhopoint's website.

## Instrument Setup Screen



The Instrument Setup screen is used to configure the instruments basic operating environment to the user's preference. Pressing the Up and Down buttons navigates through the options, pressing the Enter button selects that option.

Selectable settings in the Instrument Setup screen are:-

Language – Set instrument language to English (default), Spanish, Italian, French, German, Chinese

Screen View – Set the orientation of the screen as NORMAL, or INVERTED

Backlight – Set screen intensity to either 20%, 40%, 60%, 80% or 100% brightness

Power Off – Set instrument to automatically power off after either 30sec, 60sec, 90 sec or 120 sec or inactivity or DISABLE this feature

Power Switch – Set On/Off button to switch the instrument ON ONLY or to switch it ON & OFF

Sound – Enable or disable button press sound

USB Charge – Set the USB charge current to either 500mA or 100/500mA

Set Date & Time – Set the date and time on the instrument. Press the DOWN button to set time. Pressing the Left and Right buttons selects the date or time and the Up and Down buttons increment / decrement the value. Pressing the Enter button again saves the value.

Pressing the Left button returns the display to the home screen

## **Maintenance Screen**

The Maintenance screen is used by Rhopoint Approved Service Centres. It is PIN locked to prevent unauthorised access. There are no user configurable settings available in this menu.

Pressing the Enter button returns the display to the home screen

## **About Screen**

The About screen is for information only. It provides information relating to the instrument's software, the instrument serial number and last date of Factory Calibration. It also shows the amount of free memory available and battery power status.



# Appearance Theory

## Rhopoint Novo-Gloss Glossmeter

### Why is reflected appearance important?

A crucial factor in assessing the appearance of any manufactured product is the “glossiness” of its finish.

Gloss finishes are often used to make products visually appealing. Highly reflective, extremely smooth finishes are used to enhance the aesthetics of cars, luxury yachts and high end consumer electronics. Matt finishes are used for contrast or on furniture and architectural features.


### Gloss

Gloss is the visual sensation associated with the brightness of direct light reflected in a surface. Surfaces with high reflectance are determined as glossy; less reflective surfaces are semi-gloss or matt.

Glossmeters quantify this effect by measuring light reflection from a sample at defined angles.

The Gloss Unit (GU) is defined in international standards including ISO 2813 and ASTM D523. It is determined by the amount of reflected light from a glass standard of known refractive index.


Calibration tiles supplied with Rhopoint instruments are traceable to master glass standards held at BAM (Germany).

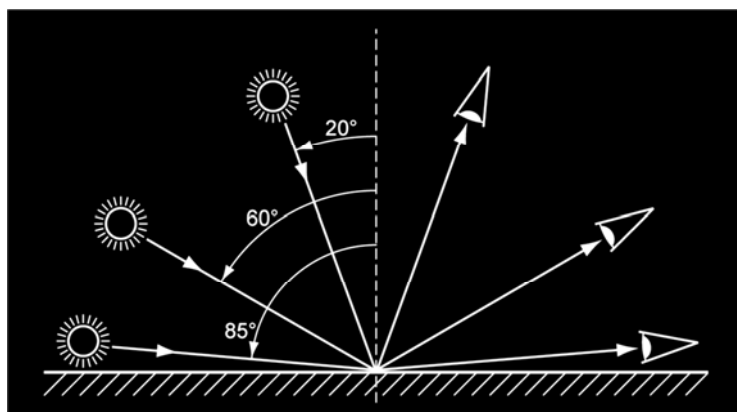

The measurement angles most commonly used for gloss are 20°, 60° and 85°.

- The most appropriate angle should be selected dependent on the glossiness of the sample surface.

- Using the correct measurement geometry increases resolution and improves the correlation of results with human perception of quality.

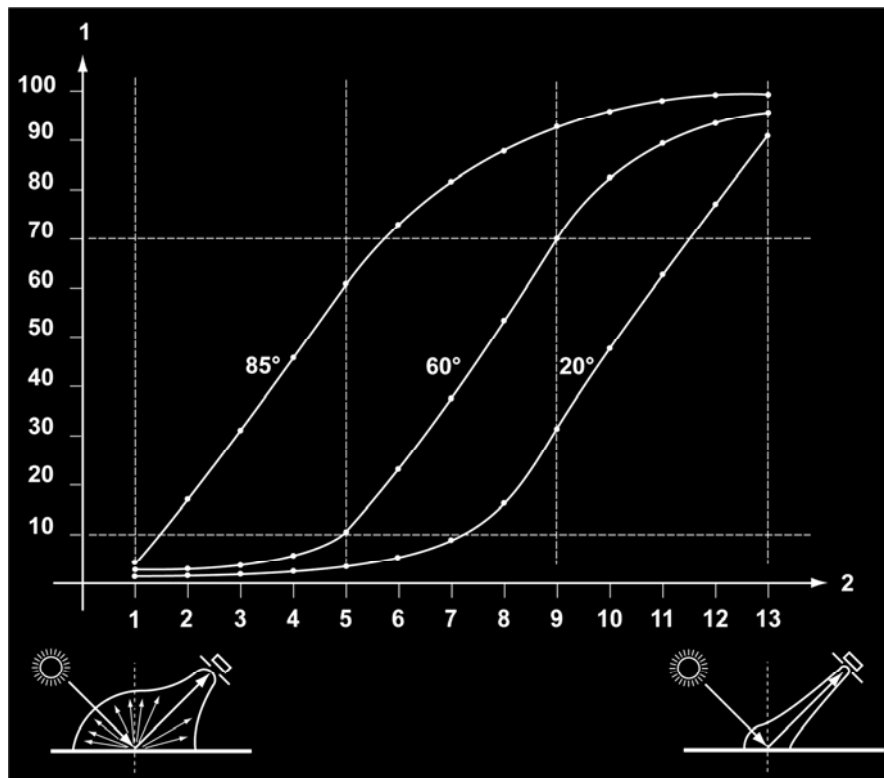

Graph showing 13 painted panels visually assessed and ranked for gloss, the measured values show 85° has improved resolution for low gloss, 60° is best suited for mid gloss and 20° should be used for high gloss.

To determine the correct measurement angle the surface should be assessed with the 60° geometry-

- Matt surfaces which measure below 10 GU @ 60° should be re-measured with the 85° angle.
- High gloss surfaces which measure above 70 GU @ 60° should be assessed using the 20° angle.
- The 60 degree angle is best employed on mid gloss samples 10-70 GU.

# Technical Specification

## **GLOSS MEASUREMENT SPECIFICATION**

60°, 20/60° or 20/60/85° Versions Available

Resolution 0.1 GU

STANDARDS: ISO 2813, ASTM D523, ASTM D2457, DIN 67530, JIS 8741, ISO 7668

## **GLOSS CALIBRATION STANDARD**

BAM Traceable

Uncertainty: 0.1 GU.

# Instrument Specification

## Colour Screen

- Adjustable Brightness 6 Button Touch Sensitive Interface

## Construction

- Aluminium soleplate & standard holder.
- Aluminium Optic chassis (20/60/85°), Injection moulded chassis (60° & 20/60°) standard holder.
- Integrated calibration holder with in position detector

## Statistical Analysis

- Max, Min, Mean, S.D.
- All measured Parameters

## Graphical Analysis

- On board trend analysis- Gloss Values

## Power

- Rechargeable Lithium Ion
- >8 Hours operation
- >10,000 Readings/Charge

## Operate from

- Internal Battery/USB/Mains Charger

## Recharge Time

- USB 2 .5 Hrs.
- Mains Charger 2 Hrs.

## Memory

- 8 MB– >999 Readings
- User definable batching

## Data Transfer

- Bluetooth

- PC & MAC compatible
- USB Connection
- No software install required

### **Dimensions & Weight**

- 65 x 140 x 50mm (H x W x D)
- 790g